UNCLASSIFIED

AD NUMBER AD923590 **NEW LIMITATION CHANGE** TO Approved for public release, distribution unlimited **FROM** Distribution authorized to U.S. Gov't. agencies only; Test and Evaluation; October 1974. Other requests shall be referred to Commander, Naval Surface Weapons Center, Dahlgren Laboratory, Dahlgren, VA 22448 **AUTHORITY** USNSWC ltr, 11 sep 1975

ACCEPTABLE LIMITS OF ROTATING BAND DAMAGE FOR 5 INCH PROJECTILES

A. S. Jennings

Reproduced From Best Available Copy









NAVAL WEAPONS LABORATORY Dahlgren, Virginia 22448


C. J. Roriz, Capt., USN OIC, and Assistant Communitar C. W. Bernard Deputy Technical

NWL Technical Report TR-3216 October 1974

ACCEPTABLE LIMITS OF ROTATING BAND DAMAGE FOR 5 INCH PROJECTILES

bу

A. S. Jennings Engineering Department

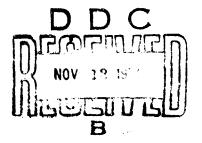

Distribution limited to U. S. Government agencies only; Test and Evaluation; October 1974. Other requests for this document must be referred to Commander, Naval Surface Weapons Center, Dahlgren Laboratory, Dahlgren, Virginia 22448.

FOREWORD

This study was conducted as a result of needs to quantify acceptable magnitudes of damage to rotating bands. It is part of the projectile design agent work being done at NSWC. The main purpose was to determine the effect of a damaged rotating band of a projectile upon its ballistic performance. Results of this study can be used as a guideline to quantify acceptable magnitudes of rotating band damage as a result of handling and workmanship.

This report was reviewed by the following:

- R. W. Lowry NSWC Design Agent Program Manager
- C. Johnson Head, Ammunition Branch, Product Engineering Division
- R. J. Arthur Head, Product Engineering Division

Released by:

J. H. MILLS, JR.

Head, Engineering Department

ABSTRACT

Twenty 5"/54 MARK 64 MOD 0 projectiles with various degrees of rotating band damage were ballistic tested. A control group with no rotating band damage was tested along with several other groups with nicks, scratches, and gouges in the rotating bands. None of the groups gave ballistic results (velocity or range) significantly different from the control group or each other. Photographs show acceptable levels of rotating band damage with respect to ballistic performance.

CONTENTS

																												Page
FORE	WORD.					•	•		•										•			•	•	•	•		•	i
ABST	RACT.					•		•		•			•	•	•			•				•	•	•	•	•	•	ii
ı.	INTRO	DUCT	TION			•	•	•			•														•		•	1
II.	DESCR	LIPT	ON (ΟF	MAT	ER	lA)	L.		•	•	•	•				•		•	•	•		•		•	•		2
IIL	TESTS	ANI) PRO	OCE	DUR	ES	•	•	•	•	•		•		•		•	•	•	•		•	•				•	12
IV.	ANALY	SIS	AND	RE	SUL	TS		•		•		•	•		•			•	•	•	•		•	•	•		•	14
v.	CONCI	USIC	ONS	•		•					•		•	•		•	•	•			•	•	•	•	•			24
VI.	RECOM	MENI	OATI(ONS				•		•		•		•				•					•		•	•		25
APPE	NDICES		ence	es																								
	B. D	istr	ibut	1.0	n																							

INTRODUCTION

Damaged copper or gilding metal rotating bands have been of great concern in the ammunition discipline for some time. NSWC has received numerous verbal and written requests to quantify acceptable limits of damage to rotating bands for 5" ammunition. The most recent request was reference (a). A naval speedletter, reference (b), was an interim reply to reference (a) and gave tentative guidelines as to acceptable damaged rotating bands. Reference (c) gave more specific guidelines and reported the work herein in abbreviated form. This report is a detail documentation of the guidelines given in reference (c).

Rotating band damage generally occurs during handling. Projectiles can be dropped, bounced against each other, or other means to incur damage to the rotating band. The high lip is especially susceptible to damaging during handling or even during fabrication of the projectile. host serious type damages generally occur at ammunition depots or aboard ships.

II. DESCRIPTION OF MATERIAL

The projectile bodies used in this study were fabricated by American Manufacturing Company of Texas (AMCOT), Fort Worth, Texas. They are 5"/54 MARK 64 MOD 0 projectiles which were sampled from production lots for acceptance tests at NSWC. Figure 1 shows the projectile body configuration and a detail sketch of the rotating band in View A. Rotating bands for this projectile are made from gilding metal (90% Cu - 10% Zn).

Twenty projectile bodies were selected from stocked acceptance rounds at NSWC. These projectiles had rotating bands free of damages. The 20 projectiles were numbered 1-20 for identification. They were then divided into 10 test groups (conditions) labeled T1-T1C with two projectiles randomly assigned to each test group. These 10 test groups composed various types and magnitudes of artificially created rotating band damage (worse than normally encountered). Cross section views of the rotating band damage are shown in Figure 2 for each group that is identified below:

Test Group	Type of Surface Flaw in Rotating Band	Notes
T1	None	Control group
T2	One high lip nick "020 deep	See Figure 3
Т3	One high lip nick "040 deep	See Figure 4
Т4	Two high lip nicks each 1020 deep	Same as shown in Figure 3 except there were two nicks 180° apart
Т5	Two high lip nicks each "040 deep	Same as shown in Figure 4 except there were two nicks 180° apart
Т6	Four high lip nicks each !040 deep	Same as shown in Figure 4 except there were four nicks 90° apart
Т7	Two scratches each 1035 deep x $1/8$ " wide across entire band	As shown in Figure 5 except there were two scratches 180° apart
Т8	Two scratches each 2070 deep x $1/\epsilon^{\prime\prime}$ wide across entire band	As shown in Figure 6 except there were two scratches 180° apart

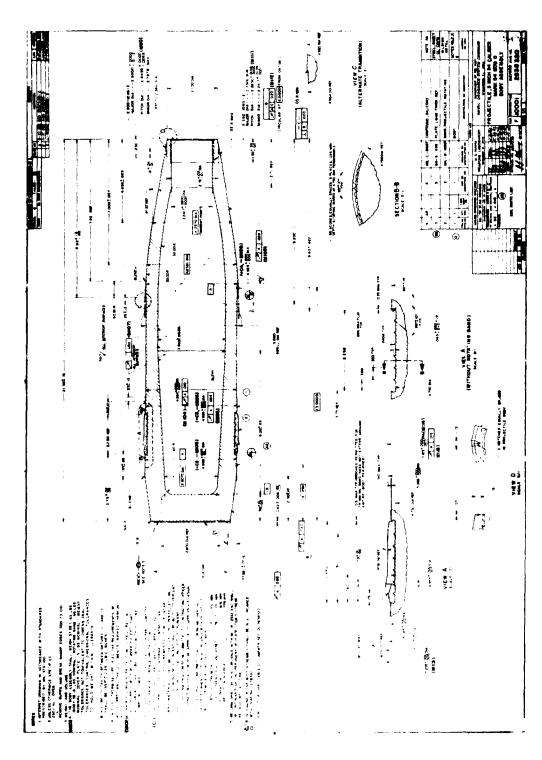


FIGURE 1

Drawing of 5"/54 MARK 64 MOD 0 Projectile Body

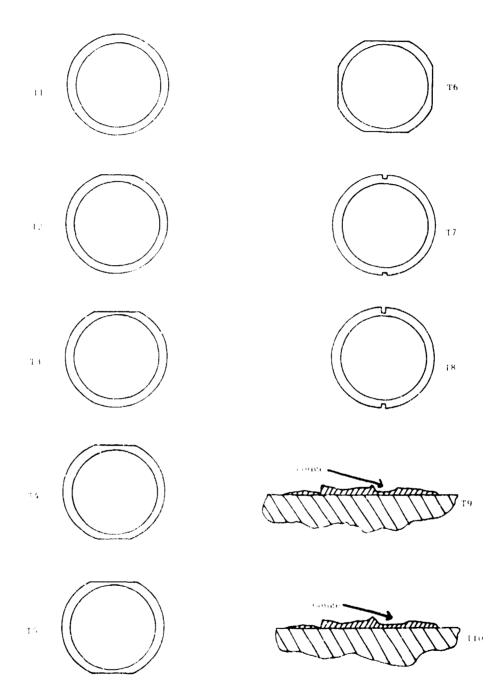


FIGURE 2

Cross Section Views of Rotating Band Flaws for the Ten Test Groups

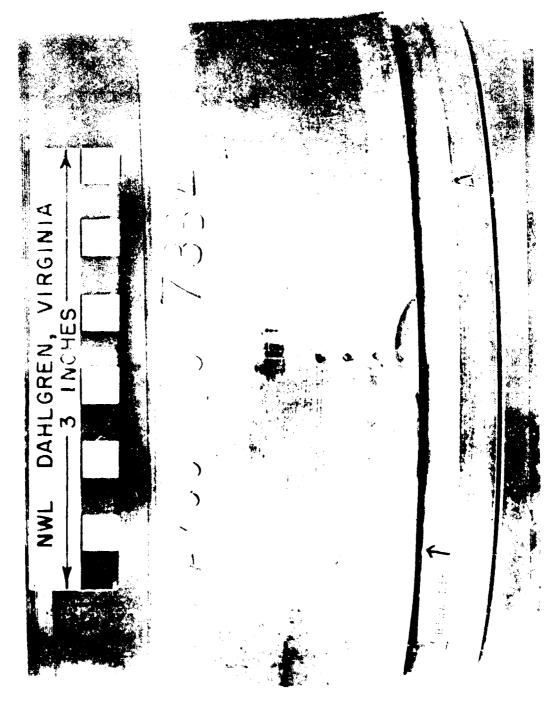


FIGURE 3

View of a Rotating Band with a High Lip Nick 0"020 Deep

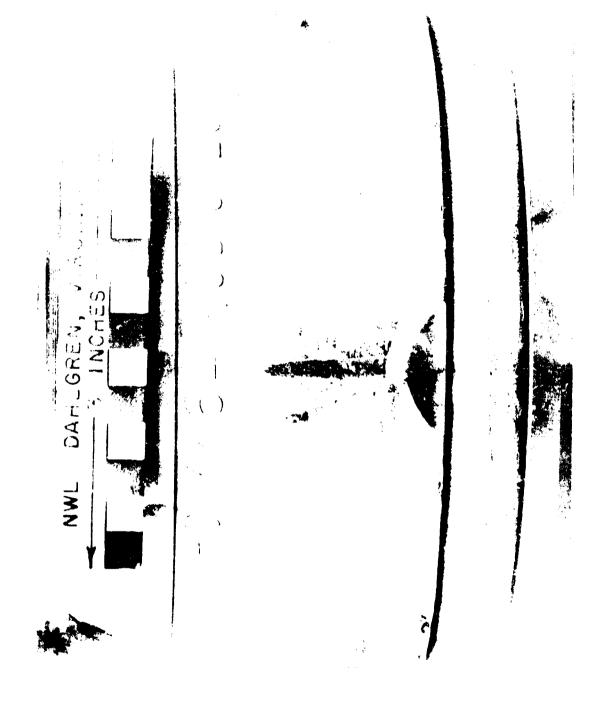


FIGURE 4 View of a Rotating Band with a High Lip Nick 07040 Deep

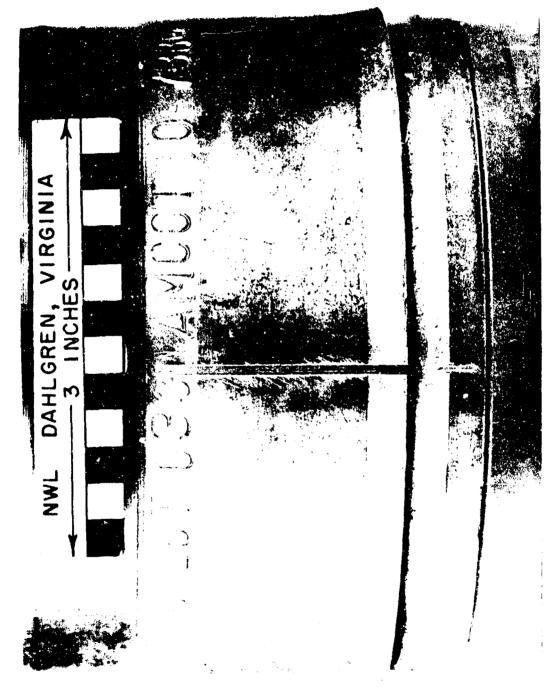


FIGURE 5

View of a Rotating Band with a Scratch 0".035 Deep



FIGURE 6

View of a Rotating Band with a Scratch 0"070 Deep

Test <u>Group</u>	Type of Surface Flaw in Rotating Band	Notes
Т9	One gouge "5 wide	See Figure 7
T10	One gouge 1"0 wide	See Figure 8

High lip nicks and scratches were machined on the rotating bands with an end mill. Gouges were placed in the rotating bands with a 1/2" and 1" cold chisel. Projectiles were placed on v blocks at the bourrelets to facilitate grinding the nicks and scratches. All depths were measured from the top of the high lip for nicks and scratches.

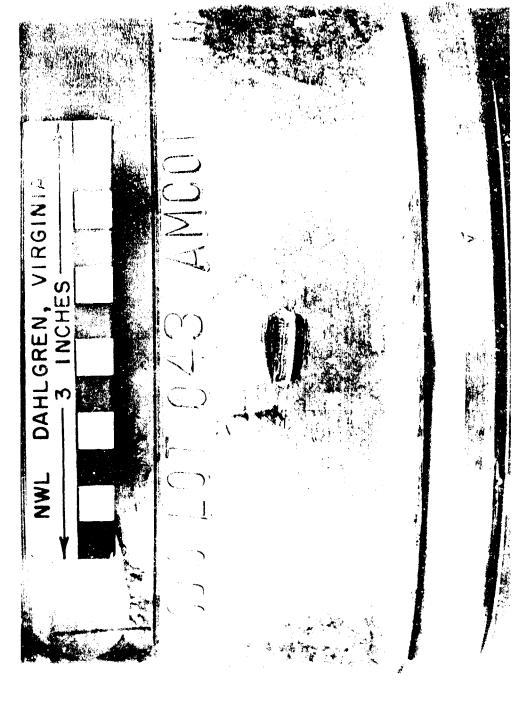


FIGURE 7

View of a Rotating Band with a 0.5 Wide Gouge

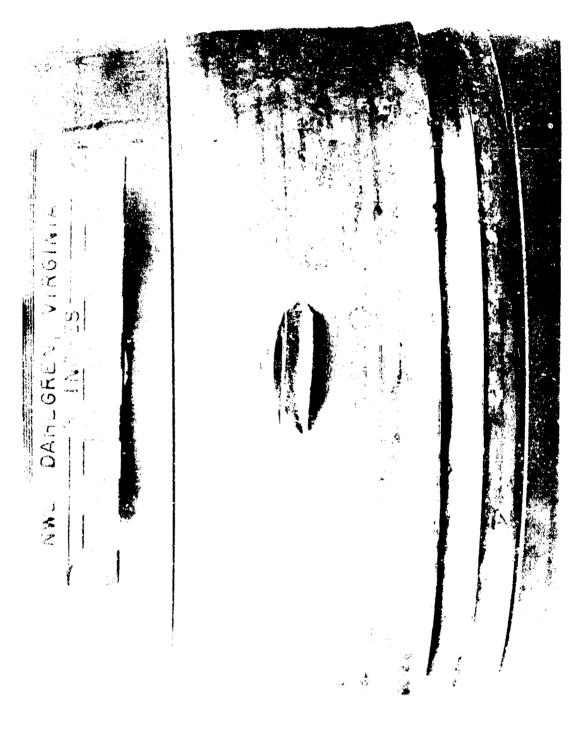


FIGURE 8

View of a Rotating Band with a 1.0 Wide Gouge

III. TESTS AND PROCEDURES

The 20 projectiles (10 test groups) were ballistically tested comparable to standard acceptance tests of projectiles at NSWC. Two projectiles were of each test group (T1-T10). All tests were conducted within 50 minutes on the same day (15 May 1974). Propellant index number SPCF-11157 (NACO Flashless) was used for all tests. A 5"/54 MARK 18 MOD 1 gun (number 16275) was used at a 15° elevation. This gun was in the third quarter gun wear life.

The projectiles were inert loaded with a filler to simulate an explosive to produce a weight of 70.00 pounds. A dummy fuze was installed on the nose of the projectiles.

Ballistic tests were conducted in a random order as given in Table 1 so as to average out unknown effects. Initial velocity, seating distance, and range were measured and are given in Table 1. Initial velocity was measured by the coil method and range by standard spotting procedures at NSWC.

TABLE 1 SUMMARY OF BALLISTIC TEST DATA

Test Group	Type of Juria o Flax Jig Rojating Band	Te st Order	Seating Distance (in)	Velocity (ft/sec)	Uncorrected Range (yds)	Corrected Range (yds)
11	None (control Group)	j jus	48.0 (1) Average	2 376 2396 2386	14326 14413 14370	15111 15040 15075
!,	tom Nove 2000 deep	17	745 ofter Swerage	2 391 2 387 2 389	14391 1442 <u>3</u> 14407	15057 15121 15089
1 1	On Nick Than her	14	49.1 (1) 2.16.14(e)	2 385 2 388 ≥ 387	14453 14328 14390	15167 15018 15092
i •	.w MakababaTek beek	: • !	v I) v I) Amerikane	2387 1587 2387	14416 14349 14383	15114 15047 15080
* *	ing the state of t	1!	48.4 48.4 Avetage	2 382 2 374 2 378	14429 14269 14349	15167 15070 15118
į ,	romodia di Podence.	} (-	142 (13) 1 (1) 1 (1)	2387 2380 2381	14 394 14 344 14 369	15132 15097 15114
	or state or the so- called deep	1.	48.0 Cla Average	2 390 2 391 2 391	14438 14435 14437	15113 15101 15107
: **	William But the State of State	•	97.7 6 - 15 - 150	2384 2384 2389	14424 14458 14441	15067 15181 15124
	e Tesan	t, 15	Ole Ole Averence	2395 2389 2392	14502 14330 14416	15137 150 <u>13</u> 15075
140	and the Control of th	* (2 .)	0.10 0.00 Victory	2398 2404 2401	14488 14493 14490	15099 15057 15078

Note that the product of the control of the control

IV. ANALYSIS AND RESULTS

Figure 9 shows a plot of uncorrected range and velocity for the 10 test groups. These data are given in Table 1. Each point in Figure 9 is an average of two tests. The tests have been categorized as control, nicks, scratches, and gouges. Test groups are identified as discussed earlier in this report (T1-T10).

A statistical method (analysis of variance) was used to determine if there is a statistically significant difference between the 10 groups with respect to uncorrected range. The analysis of variance is given in Table 2 and was computed with a computer program described in reference (d). The computed F value in the analysis of variance table is much less than the Tabled F value even at the .90 significance level (a low probability level). Consequently, we are confident that there is no statistically significant difference between the 10 test groups with respect to uncorrected range. This enables us to conclude that the different types of damaged rotating bands did not give different uncorrected range. Although Figure 9 indicates there is a difference in uncorrected range for some test groups, this difference is not greater than the error within the groups as was shown in the analysis of variance table.

Figure 9 also shows the average velocity of the two projectiles of each test group. Note that the lowest and highest velocities correspond to the lowest and highest uncorrected range; this will be discussed later in this report.

An analysis of variance was conducted with the velocity data and is given in Table 3. The computed F value here is smaller than the Tabled F value for even the .90 significance level. Therefore, it can be concluded that there is no statistically significant difference in velocity for the 10 test groups and that the different types of rotating band damage do not affect velocity.

It can be seen from Figure 9 that the two test groups with rotating band gouges gave the highest velocity. Figure 10 offers an explanation for this condition. It shows that the projectiles with gouges in the rotating band did not seat in the gun as far as the other projectiles. The large gouge had the smallest seating distance. The small gouge had a larger seating distance than the large gouge but still less than the other projectiles. This decrease in seating distance was probably caused by the burrs of the rotating band gouges shown in Figures 7 and 8. Burrs such as shown here would prevent the projectile from being rammed into the gun the normal distance (as measured by seating distance) and would consequently cause a higher velocity. Reference (e) shows that there is an inverse relationship between seating distance and velocity as shown in Figure 10. Even though the analysis of variance of velocity showed that there is no significant difference in velocity for the different

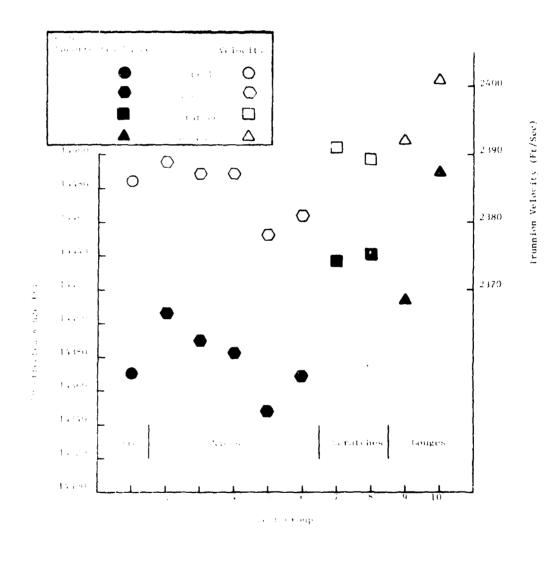


FIGURE 9

Average Uncorrected Range and Velocity for the Ten Test Groups

TABLE 2

ANALYSIS OF VARIANCE (UNCORRECTED RANGE)

Source of Variation	Note the Square of the Square	т факц Комплек	Series Consum	Para Santa A		
Setween Groups	32264	3 7	†000g	ा के च	7	:2 :;
Within troups	C50287	10	7.25		· ·	9.
						;
TOTAL	76095	19				

Hypothesis

Ho: All ten groups are equal

 H_{o} cannot be rejected since the Computed F Value is less than the Tabled F Value. Conclusion

There is no statistically significant difference in the ten groups with respect to uncorrected range.

TABLE 3

ANALYSIS OF VARIANCE (VELOCITY)

Tabled F Value	F.90 (9,10) = 2.35	т	.95 (9.10) = 3.02	$F_{.99}$ (9,10) = 4.94
Computed F Value	2.33			
Mean Square	77.6	33.3		
Degrees of Freedom	6	10		19
Sum of	669	333		1032
Source of Variation	sdnoro neonos	Within Groups		TOTAL


Hypothesis


Ho: All ten groups are equal

Conclusion:

 ${\rm H_o}$ cannot be rejected since the computed F value is less than the tabled F value.

There is no statistically significant difference in the ten groups with respect to velocity.

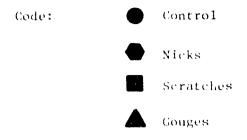

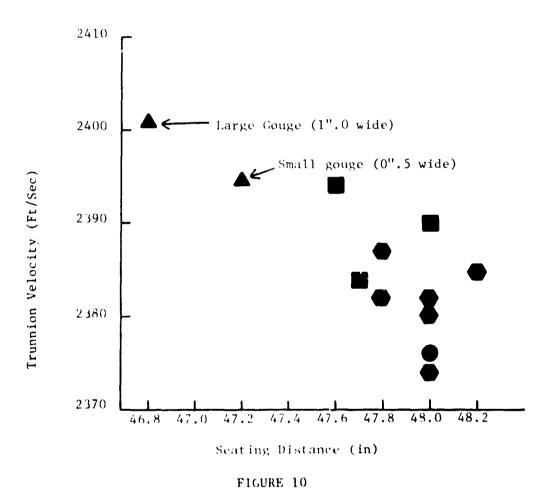

Relationship Between Velocity and Seating Distance for Projectiles with Damaged Rotating Bands

test groups; it is evident that burrs from gouges can cuase a decrease in seating distance and subsequent increase in velocity.

The uncorrected range was corrected for velocity and weather according to standard correction procedures. Weather correction was constant for all projectiles but velocity correction varied for different projectiles. It was especially necessary to correct for velocity variation after considering the earlier discussion on velocity.

Figure 11 shows the average corrected range for each of the 10 test groups. Note that the difference here between the test groups is much less than that for the uncorrected range shown in Figure 9. It can be seen from Figure 11 that the various test groups deviate very little from each other. The analysis of variance for corrected range is given in Table 4. It shows (because of the small computed F value) that there is no statistically significant difference between the 10 test groups with respect to corrected range which is the same conclusion as derived from analysis of uncorrected range data. This enables us to conclude that the different types of damaged rotating bands did not give different corrected range.

Dunnett's t statistic was also computed for the three sets of data (velocity, uncorrected range, and corrected range) and is given in Table 5. This statistic is described in reference (f). It is a good method to compare each of several treatments with a control treatment. In the case herein, there are nine groups (T2-T10) to be compared with a control group (T1). Table 5 gives Dunnett's t for the three sets of data and the formula for computing it. The hypotheses for this statistic are:

Ho: mean of group j=mean of control group where j = 2 to 10

Ha: mean of group $j\neq$ mean of control group where j = 2 to 10

Reject Ho if the Dunnett's t statistic is greater than or less than the critical values given in Table 5. Dunnett's t was not greater or less than the critical value for any of the comparisons in Table 5. Therefore, we can conclude the following:

- a. Neither of groups 2-10 were different from the control group with respect to uncorrected range, velocity, or corrected range.
- b. The damaged rotating bands did not influence the ballistic performance of projectiles for the test conditions studied in this report

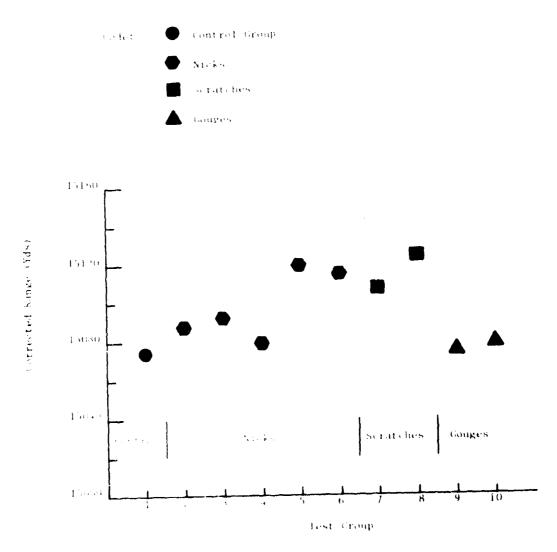


FIGURE 11

Average Corrected Range for the Ten Test Groups

TABI.E 4

ANALYSIS OF VARIANCE (CORRECTED RANGE)

Tabled F	$F_{.90}(9.10) = 2.35$	$F_{.95}(9,10) = 3.02$	$F_{99}(9,10) = 4.94$
Computed F	0.19		
Mean Square	719.3	3837.1	
Degrees of Freedom	ō·	10	19
Sum of	5259	38370	44844
Source of Variation	Between Groups	Kithin Groups	TOTAL

Hypothesis

 $H_{\mathbf{O}}$: All ten groups are equal

Conclusion

 $extsf{H}_{ extsf{o}}$ cannot be rejected since the Computed F Value is less than the Tabled F Value.

There is no statistically significant difference in the ten groups with respect to corrected range.

TABLE 5

Dunnett's t Statistic for Comparing Each Group with the Control Group for Uncorrected Range, Velocity, and Corrected Range

Group Compared with Control Group	Dunnett's t for Uncorrected Range	Dunnett's t for Velocity	Dunnett's & for Corrected Range
T2	0.56	0.52	0.22
Т 3	0.30	0.17	0.27
T4	0.20	0.17	0.08
Т5	-0.32	-1.39	0.69
Т6	-0.02	-0.87	0.63
Τ7	1.01	0.87	0.52
Т8	1.07	0.52	0.79
Т9	0.70	1.04	0.00
T10	1.81	2.60	0.05

Critical Values: $\alpha = .05$, $t=\pm 3.46$ $\alpha = .01$, $t=\pm 4.47$

Dunnett's
$$t$$
:
$$t = \frac{\bar{T}_{j} - \bar{T}_{1}}{\sqrt{2 M S_{error}/N}}$$

where $T_1 \approx \text{mean of control group}$

 \overline{T}_{j} = mean of group j, j = 2 to 10

 ${
m MS}_{
m error}$ = within group mean square from analysis of variance table

N = number of observations per group, two in this case

The D/R test acceptance limit is .70% for projectiles. The 20 projectiles tested herein had a D/R (corrected) of .26%. This also is indicative of the lack of difference in ballistic performance even though most of the rotating bands had damage of various degrees.

V. CONCLUSIONS

- (1) It takes a serious damage in a rotating band to affect the ballistic performance of a projectile.
 - (2) Acceptance limits for damaged rotating bands are:
- (a) No more than four dents or nicks up to 0.040 inch deep in the high lip are acceptable.
- (b) No more than two scratches up to 0.070 inch deep \times 1/8 inch wide aligned in the longitudinal direction of the projectile and covering the entire band length are acceptable.
- (c) No more than one large gouge (1" \times .047 deep) is acceptable.
- (3) Gouges in a rotating band can decrease the projectile seating distance slightly and consequently increase velocity, but not to a significant level.

VI. RECOMMENDATIONS

- (1) Results of this study should be used to determine acceptable limits and types of damage to rotating bands.
- (2) Rotating band specifications should incorporate the results of this study where applicable.
- (3) This information should be disseminated to loading depots, ships, and other necessary activities in order to prevent waste of projectiles.
- (4) DCAS personnel at projectile manufacturing facilities should be advised of this study and its results.

APPENDIX A

REFERENCES

- (a) SPCC msg R050820Z Apr 1974
- (b) NWL spdltr EPD:JCN:bpc 8033/21 of 30 Apr 1974 to NAVORDSYSCCM (NAPEC)
- (c) NWL spdltr EPD:ASJ:bpc 8033/21 of 29 May 1974 to NAVORDSYSCOM (NAPEC)
- (d) Biomedical Computer Program; BMDO1V Analysis of Variance, University of California, Los Angeles, April 1973 version
- (e) J. S. O'Brasky, NWL Technical Report TR-3081, March 1974, "Investigation of Projectile Seating Distance Measurement as a Muzzle Velocity Calibration Technique"
- (f) B. J. Winer, "Statistical Principles in Experimental Design", p.89, McGraw-Hill Book Company 1962

APPENDIX B

DISTRIBUTION

Naval Sea Systems Command Washington, D. C. 20362

Attn: SEA-992

SEA-992B SEA-9921 SEA-9923 SEA-9926

Technical Library

Director of Defense Research and Engineering Washington, D. C. 20390

Attn: Technical Library

Director

Naval Research Laboratory Washington, D. C. 20390

Attn: Technical Library

Director

Naval Ship Research and Development Center Washington, D. C. 20034

Attn: Technical Library

Office of Naval Research Department of Navy Washington, D. C. 20360

Attn: Technical Library

Commander

Naval Surface Weapons Center

White Oak, Silver Spring, Maryland 20910

Attn: Code 730

Technical Library

Commander

Naval Weapons Center

China Lake, California 93555

Attn: Technical Library

Commanding Officer Naval Weapons Station Concord, California 94520 Commanding Officer
Naval Ordnance Station
Indian Head, Maryland 20640
Attn: Jack Worthington
Technical Library

Commanding Officer
Naval Weapons Station
Yorktown, Virginia 23691
Attn: Yancey McGann
Technical Library

Superintendent
Naval Postgraduate School
Monterey, California 93940
Attn: Technical Library

Superintendent
U. S. Naval Academy
Annapolis, Maryland 21402
Attn: Library

Air Force Armament Laboratory
Eglin Air Force Base, Florida 32542
Attn: DLD
Technical Library

Air Force Weapons Laboratory
Kirtland Air Force Base, New Mexico 87117
Attn: Technical Library

Commander
Frankford Arsenal
Philadelphia, Pennsylvania 19137
Attn: SARFA-16400
SARFA-16300
Technical Library

Commanding Officer
Picatinny Arsenal
Dover, New Jersey 07801
Attn: Technical Library

Commanding Officer
Ballistics Research Laboratories
Aberdeen Proving Ground, Maryland 21005
Attn: Technical Library

```
Commanding Officer
Naval Ammunition Depot
Crane, Indiana 47522
       Attn: R&D
Defense Documentation Center
Cameron Station
                                                                     (2)
Alexandria, Virginia 22314
Local:
D
E
F
G
K
T
TF
TT
то
TP
TPB
TPB(Bumbry)
TPD
GX
GA
GB
GBR
GBC
GBW
GP
GW
GC
ES
ESE
EJ
EJP
EJM/Q
EJD(Payne)
EP
EPM
EPA
                      (20)
EPD
                     ( )
MIL
MIP-3
                      (5)
```

MIP-2 MIM

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE	READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER 2. GOVT ACCESSION NO	3. RECIPIENT'S CATALOG NUMBER
TR-3216	
4. TITLE (and Subtitle)	5. TYPE OF REPORT & PERIOD COVERED
ACCEPTABLE LIMITS OF RATATING BAND DAMAGE FOR	
5 INCH PROJECTILES	5. PERFORMING ORG. REPORT NUMBER
	6. PERFORMING ORG. NEF-GIV. NGMB-
7. AUTHOR(s)	8. CONTRACT OR GRANT NUMBER(8)
A. S. Jenninas	
9. PERFORMING CISIAN TATE OF NAME AND ADDRESS	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
	AREA & WORK UNIT NUMBERS
Naval Surface Weapons Center Dahlgren Laborator,	
DAHLGREN, Va. 444	
11. CONTROLLING DEFELL WANS AND ADDRESS	Oct 1974
	13. NUMBER OF PAGES
	13. NUMBER OF TRACE
14. MONITORING AGENTS NAME & ACORESSILI different from Controlling Office)	15. SECURITY CLASS. (of this report)
	UNCLASSIFIED
	150 DECLASSIFICATION/DOWNGRADING
	15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
Naval Surface Weathers Center, Dahlgren Laboratory 17. DISTRIBUTION STATEMENT of the ebaliact entered in Block 20, if different fr	
19. KEY WORDS (Commune on an entire Aide of the expert and identify by block number	r)
20. ABSTRACT (Continue of the case and it necessary and identity by block number 'Twenty 5"/54 M.RF. 64 MOD 0 projectiles with valband damage were ballistic rested. A control grodamage was tested along with several other groups gouges in the remaining bands. None of the groups (velocity or normal) significantly different from	rious degrees of rotating up with no rotating band with nicks, scratches, and gave ballistic results

DD 1 JAN 73 1473

TO SEE THOU SEELS OBSOLETE

UNCLASSIFIED